

4. Bend the scarf over the horn of the anvil to make the slope slightly rounding, as shown in Fig. 43. The scarfs must be shaped with a convex curve if the weld is to be successful.

5. The length of the scarf should seldom exceed one and one-half times the thickness or diameter of the iron.

#### Always observe the following directions when welding:

1. Use little draft in your fire. Heat the iron slowly and turn occasionally so that both sides will reach the welding temperature at the same time.

2. Have burning coke above, below and to the sides of the iron while heating.

3. The welding heat has been reached when the iron looks like melting ice, and appears to be melting on the surface. When tiny explosive sparks shoot off from it the iron is *burning*. It is not too late to weld the iron when the first sparks appear.

4. Quickly remove the iron from the fire to the face of the anvil, place the two scarfs together and strike a couple of light blows on the weld, followed by several heavy blows. Strike the weld on both sides of the iron.

5. Shape the welded part to conform with the shape of the iron, and then shape the object, if that is necessary.

### WELDED RING

#### How to Make a Welded Ring

1. Read and study the Lap Weld and Plate 18 first.

2. Upset both ends of the stock, Plate 19, and scarf the ends like B, Plate 18.

3. Bend in a circle and into position for welding, and make the weld.

4. Shape the iron round and to size at the place of welding.


5. Shape the ring over the horn of the anvil, or a mandrel if you have one. The completed ring is shown in Fig. 38.



FIG. 38.  
WELDED RING.


# WELDED RING

Stock  
 $\frac{1}{2}'' \times 9\frac{7}{8}''$  - Round

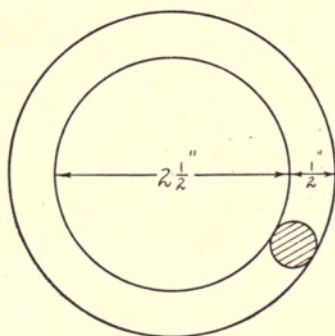

# PILE BAND

Stock  
 $\frac{1}{4}'' \times 1\frac{1}{4}'' \times 17''$

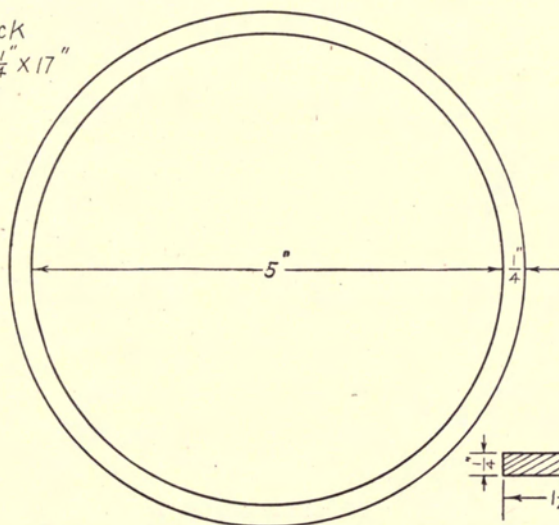

UNIVERSITY OF CALIFORNIA

# FARM BLACKSMITHING

A TEXTBOOK AND  
PROBLEM BOOK FOR STUDENTS IN AGRICULTURAL  
SCHOOLS AND COLLEGES, TECHNICAL  
SCHOOLS. AND FOR FARMERS

BY  
JOHN F. FRIESE

Head of the Machine Shop and Forging Departments,  
Technical High School, St. Cloud, Minn.

*Author of "Blueprinting"*



THE MANUAL ARTS PRESS  
PEORIA, ILLINOIS

TO THE  
ADMINISTRATOR

TT220  
F7  
Vocat.  
educ.

*Vocational Educ. Division*

COPYRIGHT 1921

• JOHN F. FRIESE

Public Domain Bookmarks and Links  
Added by Allen Dyer. December, 2007  
Blacksmith Guild of Central Maryland  
Publications Committee

Printed in the United States of America